

### Ockam to AirMar CS4500 operation

1. The CS4500 should be hooked up per instructions then add a jumper wire from the terminal block marked "Battery" (RED) to the terminal block marked "Instrument" (RED).
2. Now run a wires from "Instrument" (BARE) to the 016K BOATSPEED PIGTAIL (TNC) shield and (GRN) to the 016K center for the 015 Boatspeed Interface. On the T2 Multiplex interface run those wires to Gnd (3) and Port (4). Note: Pull up resistors will **NOT** be required.
3. Set the signature switch to position "B" (5.56hz/Knot)